

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

CHILD SEATS:

None during June 2013.

EQUIPMENT:

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain replacement lithium-ion batteries installed on certain 2012 Mitsubishi i-MiEV vehicles. The batteries were manufactured December 18, 2012, through December 21, 2012. The batteries may have internal contamination possibly causing reduced voltage. Also, the batteries may also develop a short-circuit during charging. Internal contamination of the battery may cause reduced voltage resulting in a stall-like condition, increasing the risk of a crash. Mitsubishi will notify the owners instructing them to take their vehicle to a dealer where the batteries will be replaced free of charge. The recall is expected to begin during July 2013. Owners may contact Mitsubishi at 1-800-222-0307. Mitsubishi's recall number is SR-13-006.

13E-031

Stoneridge Inc. (Stoneridge) is recalling certain ignition switches, part numbers 31-110, 31-397, 31-400, 31-322, 31-409, 31-458, 31-498-01P, and 31-610, all with date code 183. The ignition switch may contain an internal defect that may cause the starter to engage when a key is partially inserted, before the key is turned. Unintended engine startup could cause injury to a person working in the engine compartment. Additionally, vehicles with standard transmissions may experience unexpected movement, which may result in personal injury or a crash. Stoneridge will replace the ignition switches, free of charge. The manufacturer has not yet provide a notification schedule. Owners may contact Stoneridge at 1-781-830-0340.

13E-032

Kuryakyn Holdings, LLC (Kuryakyn) is recalling certain model 1660 (chrome finish) motorcycle backrests manufactured from March 2012 to May 2013; and model 1661 (black and chrome finish) motorcycle backrests manufactured from August 2012 to May 2013. The backrest pivot screws may come loose and cause the backrest to separate from the motorcycle. If the backrest separates while the motorcycle is in motion it could cause the rider to lose control and possibly fall off, increasing the risk of injury. Additionally, the separated backrest may be a road hazard. Kuryakyn will notify customers and instruct them to visit their nearest motorcycle dealer to have replacement screws installed. The service will be done at no cost to the owner. The recall began on June 13, 2013. Owners may contact Kuryakyn at 1-866-296-4728.

13E-033

Ohlins Racing AB (Ohlins) is recalling certain steering dampers manufactured with an incorrectly machined bracket. These dampers were sold for use as aftermarket equipment on BMW S1000RR and R1200R motorcycles. The affected brackets may crack. If there is a crack in the steering bracket, at low speeds it may cause the steering to lock, leading to personal injury or a crash. Ohlins will notify the distributors and provide their customers with a new bracket. The recall is expected to begin in July 2013. Owners may contact Ohlins USA at 1-828-692-4525.

13E-034

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

Sutrak USA (Sutrak) is recalling certain HVAC Systems manufactured May 2012 through May 2013 used in DART 39000 buses manufactured by North American Bus Industries, Inc. The fuse holder inside the HVAC may allow voltage spikes, which may damage electrical components. Damage to electrical components may result in a fire. Damage to electrical components may result in a fire. Sutrak has been working with the bus manufacturer and the affected fleet and will replace the fuse holders, free of charge. The recall is expected to begin in late June 2013. Owners may contact Sutrak at 1-303-287-2700.

13E-035

TIRES:

GITI Tire Company Ltd. (GITI) is recalling certain Runway P235/60 R16 Enduro 816 tires manufactured in the second week of 2013 (DOT code 0213). Due to a tire mold issue, the tires may develop splits in the shoulder. The tires may experience rapid air loss while driving, possibly resulting in tire failure and increasing the risk of a crash. GITI will notify owners and dealers will replace the tires, free of charge. The recall began on June 24, 2013. Owners may contact GITI Tire at 1-866-488-4737.

13T-005

VEHICLES:

Navistar is recalling certain model year 2012-2013 International brand ProStar and TranStar commercial trucks, manufactured from August 01, 2011, through July 10, 2012, and equipped with front brake linings listed as feature codes 0504501, 0504504, or 04EWM. The brake S-Cam tube bracket assemblies on the steer axles may fracture. Brake assembly fractures may result in an inoperative brake on the affected wheel. This will cause the vehicle to pull to one side unexpectedly during breaking and/or increase the stopping distance. Either result may increase the risk of a vehicle crash. Navistar has already notified all affected owners about the defect during the course of the 2012 campaign that did not launch due to parts delays. The remedy is expected to be available in August 2013. Dealers will replace the S-Cam tube bracket assemblies, free of charge. Owners may contact Navistar at 1-800-448-7825. Navistar's number for this recall is 12530. This recall supersedes recall 12V-546.

13V-231

Chrysler Group LLC (Chrysler) is recalling certain model year 2010-2012 Jeep Compass and Patriot vehicles manufactured May 6, 2008, through July 20, 2012. The affected vehicles have a software error which may result in a delayed deployment or non-deployment of the seatbelt pre-tensioners and/or side airbags. In the event of a rollover necessitating airbag deployment, the software error can lead to a delayed deployment or non-deployment of the side curtain airbag and/or seatbelt pre-tensioners. As a result, vehicle occupants have an increased risk of injury in a crash. Chrysler will notify owners, and dealers will correct the software free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall number is N01.

13V-233

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

Chrysler Group LLC (Chrysler) is recalling certain model year 2012-2013 Jeep Wrangler vehicles equipped with a 3.6L engine and an automatic transmission and manufactured January 23, 2011, through February 23, 2013. The power steering line may contact and wear a hole in the transmission oil cooler line resulting in a loss of transmission fluid. A loss of transmission fluid may result in a loss of transmission function which may increase the risk of a crash. Chrysler will notify owners, and dealers will replace the power steering return tube assembly, free of charge. The recall is expected to begin during July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N28.

13V-234

Toyota is recalling certain model year 2010 Prius vehicles manufactured March 31, 2009, through October 9, 2009; and model year 2010 Lexus HS250h vehicles manufactured June 19, 2009, through October 9, 2009. Nitrogen gas from a component of the brake booster pump assembly could leak into the brake fluid. As nitrogen is released into the brake fluid, the brake pedal may have reduced hydraulic pressure. Under certain circumstances, this condition could affect stopping distance and increase the risk of a crash. Toyota will notify owners, and dealers will replace the affected brake booster pump assemblies. The recall is expected to begin late July 2013. Owners may contact Toyota at 1-800-331-4331.

13V-235

Mercedes-Benz (Mercedes) is recalling certain model year 2013 SLK250 and SLK350 vehicles manufactured October 9, 2012, through November 20, 2012. These vehicles are equipped with an occupant classification system (OCS) that may not correctly differentiate between a child seat or a very light person being in the front passenger seat. If the OCS incorrectly classifies a very light person as being a child seat, in the event of a crash necessitating airbag deployment, the system would deactivate the passenger airbag, increasing the risk of injury. Mercedes will notify owners, and dealers will replace the passenger side seat cushion including the OCS. The recall is expected to begin during July 2013. Owners may contact Mercedes at 1-201-573-0600.

13V-236

Chrysler is recalling certain model year 2013 Ram 1500, 2500, and 3500 trucks manufactured September 9, 2012, through March 5, 2013 and equipped with optional premium tail lamps. In the affected vehicles, the turn signal indicator may not flash at a double rate to give a notification to the driver of a turn signal malfunction. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." Without a warning that the turn signal is malfunctioning, the driver would continue to use the vehicle, unaware that other drivers on the road are not being notified that the vehicle is turning, increasing the risk of a crash. Chrysler will notify owners, and dealers will reprogram the Central Body Controller software, free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-853-1403. Chrysler's recall campaign number is N35.

13V-237

Chrysler Group LLC (Chrysler) is recalling certain model year 2013 Dodge Dart vehicles manufactured March 1, 2012, through February 28, 2013 and equipped with a 1.4L MultiAir turbo engine and dual dry clutch transmission. These vehicles may experience an engine stall when the temperature is 20 degrees Fahrenheit or colder. If the engine stalls while driving it may increase the risk of a crash. Chrysler will notify owners, and

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

dealers will reprogram the powertrain control module, free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N32.

13V-238

Chrysler Group LLC (Chrysler) is recalling certain model year 2012 RAM 4500 and 5500 trucks manufactured February 2, 2012, through the end of model year 2012. Due to a welding issue with the front axle carrier, the front drive shaft may fracture and result in a loss of motive power and damage to surrounding components if the shaft continues to spin. Damage to other components, or sudden loss of drive power may increase the risk of a crash. Chrysler will notify owners, and dealers will replace or repair the front axle assembly, free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N26.

13V-239

Chrysler is recalling certain model year 2013 Ram 2500 and 3500 trucks manufactured January 7, 2013, through February 28, 2013 and equipped with optional premium headlamps. The headlamp shutters may function improperly when in high-beam mode. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." Improper headlight shutter function during high beam use may reduce the drivers visibility and possibly blind oncoming traffic. Either condition may increase the risk of crash. Chrysler will notify owners, and dealers will reconfigure the Central Body Controller, free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N33.

13V-240

Jayco is recalling certain model year 2014 White Hawk travel trailers manufactured May 17, 2013, through May 21, 2013. The A/C to D/C converter may not be properly grounded to the frame. If the converter is not properly grounded to the frame, there may be an excessive buildup of heat and melting of the wiring, possibly resulting in a fire. Jayco will notify owners and dealers will inspect the wiring for the converter. If needed, they will add the provided ground wire, free of charge. The recall began on June 21, 2013. Owners may contact Jayco at 1-800-283-8267.

13V-241

Spartan Motors, Inc. (Spartan) is recalling certain model year 2012-2013 K2, K3, and MM motor homes manufactured March 2, 2012, through July 30, 2012 and equipped with a 1660 independent front suspension supplied by Reyco Granning. The motor homes may have incorrect wheel bearings installed in the front suspension. Incorrect wheel bearings may cause the vehicle to pull to one side and with continued use, there is a risk of a fire starting at the wheel. Spartan will notify owners and dealers will inspect the bearings and replace them, as needed, free of charge. The recall began on July 8, 2013. Owners may contact Spartan at 1-517-543-6400. Spartan's campaign number is 13-009.

13V-242

PACCAR is recalling certain model year 2013-2014 T440 trucks manufactured July 19, 2012, through March 20, 2013. The tread plate is installed on the entry steps such that it does not align with the cab door opening.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

As such, it leaves a section of the step without sufficient slip prevention. The absence of a slip-resistant surface could cause a person to slip and become injured while climbing into or out of the cab. PACCAR will notify owners and dealers will install a new step assembly free of charge. The recall is expected to begin by mid July 2013. PACCAR's recall number is 13KWG. Owners may contact PACCAR at 1-425-468-7400.

13V-243

PACCAR is recalling certain model year 2014 Kenworth T470 and T800 trucks manufactured January 1, 2013, through January 22, 2013. A parameter in the Electronic Service Analysis (ESA) tool was mistakenly switched to disable the start-in-gear protection feature. Because of this, the vehicles may be started when the automatic transmission is in gear. If the vehicle is started while it is in gear, it may move unexpectedly, increasing the risk of a crash. PACCAR will notify owners and dealers will correct the ESA parameter, free of charge. The recall is expected to begin by mid July 2013. PACCAR's recall number is 13KWH. Owners may contact PACCAR at 1-425-468-7400.

13V-244

McNeilus Truck and Manufacturing, Inc. (McNeilus) is recalling certain Bridgmaster V Concrete Mixers equipped with Hendrickson trailer axles using a square axle cross tube, produced between September 9, 2011 and May 8, 2013. In the affected vehicles, the fender may be insufficiently tightened to the trailing axle and the fender mounting bracket can crack and fail potentially resulting in the fender and/or fender tube detaching from the axle. If components of the fender detach from the vehicle, it may create a road hazard, increasing the risk of a crash. McNeilus will notify owners, and service facilities will replace the fender brackets and new mounting hardware, free of charge. The recall began on July 5, 2013. Owners may contact McNeilus at 1-888-686-7278 or by email at mtmrefuseservice@mcneilusco.com. McNeilus's recall number is 41-0967369.

13V-245

American Honda Motor Co., Inc. (Honda) is recalling certain model year 2006 Acura RSX vehicles manufactured January 18, 2006, through August 12, 2006; and model year 2006-2007 Honda S2000 vehicles manufactured January 19, 2006, through November 13, 2006. The brake booster may be unable to maintain a vacuum when the brake pedal is depressed, decreasing brake assist. With reduced braking assistance, the vehicle may require additional brake pedal force to prevent a lengthened stopping distance, increasing the risk of a crash. Honda will notify owners, and dealers will inspect the brake booster assembly. If necessary, the dealers will replace the booster assembly free of charge. The recall is expected to begin during July 2013. Owners may contact Honda at 1-310-783-2000. Honda's recall number is JA4. Acura's recall number is JA5.

13V-246

North American Bus Industries, Inc. (NABI) is recalling certain model year 2003-2013 45CLFW and 2013 40CLFW transit buses manufactured November 1, 2008, through June 7, 2013. The air brake pedal mounting may become loose during application of the brake pedal. If the brake pedal comes loose during use, the driver may not be able to apply the brakes as expected and required, increasing the risk of a crash. NABI will notify owners and inspect and repair the buses, free of charge. The recall is expected to begin during July 2013. Owners may contact NABI at 1-256-241-1298. NABI's recall number is 20134.

13V-247

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

General Motors (GM) is recalling certain model year 2006 Chevrolet Trailblazer EXT and GMC Envoy XL and 2006-2007 Chevrolet Trailblazer, GMC Envoy, Buick Rainier, SAAB 9-7x, and Isuzu Ascender vehicles. Fluid may enter the driver's door module, causing corrosion that could result in a short in the circuit board. A short may cause the power door lock and power window switches to function intermittently or become inoperative. The short may also cause overheating, which could melt components of the door module, producing odor, smoke, or a fire. A short in the circuit board could lead to a fire, increasing the risk of personal injury. A fire could occur even while the vehicle is not in use. As a precaution, owners are advised to park outside until the remedy has been made. Owners will be contacted and dealers will test the driver's door module. If the module is functioning properly, a protective coating will be applied. If the module is not functioning properly, it will be replaced. These repairs will be done free of charge. GM will notify Buick, Chevrolet, and GMC owners, Isuzu and Saab will contact their respective owners. The recall is expected to begin July 24, 2013. Buick owners may contact the owner center at 1-800-521-7300, Chevrolet owners at 1-866-694-6546, GMC owners at 1-866-996-9463, Isuzu owners at 1-800-255-6727, and SAAB owners at 1-855-880-0808. GM's campaign number is 12180. This recall is an expansion of recall 12V-406.

13V-248

Tesla Motors, Inc. (Tesla) is recalling certain model year 2013 Model S electric vehicles manufactured May 10, 2013, through June 8, 2013. An improper method for aligning the left hand seat back striker to the bracket may have weakened the weld between the bracket and the frame of the vehicle. In the event of a crash, the left hand seat back may not stay mounted, increasing the risk of injury to passengers. Tesla will notify owners, and dealers will inspect the left hand second row strikers. Tesla will add additional mounting hardware to ensure a proper joint between the bracket and the frame, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tesla at 1-650-681-5000.

13V-249

Temsa Global is recalling certain model year 2011-2013 TS35C motorcoach buses manufactured November 2010 through May 2013 and 2012-2013 TS30 motorcoach buses manufactured November 2011 through April 2013 and equipped with 3-point seat belts. The bolts used for the installation of the seat were tightened over their torque specification which may cause the bolts to fail. In the event of a crash, the bolts may break, failing to properly anchor the seat, increasing the risk of injury. Temsa Global will notify owners and dealers will replace the existing bolts with new ones. The recall began on July 9, 2013. Owners may contact CH Bus Sales at 1-407-271-8935.

13V-250

Forest River, Inc. (Forest River) is recalling certain model year 2014 Sunseeker, Forester, Lexington, and Solera motorhomes manufactured between April 1, 2013, through May 21, 2013. The battery isolation manager (BIM) can develop a short circuit. A short circuit may result in smoke, melting or a fire. Forest River will notify owners and will replace the BIM. The recall is expected to begin during July 2013. Owners may contact Forest River Customer Service at 1-574-206-7600.

13V-251

Chrysler Group LLC (Chrysler) is recalling certain model year 1993-1998 Jeep Grand Cherokee and 2002-

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

2007 Jeep Liberty vehicles. The fuel tanks in these vehicles are at risk of failure and leakage in certain rear impacts. A fuel leak in the presence of an ignition source may result in a fire. Chrysler will notify owners, and dealers will inspect the rear structure. On vehicles in the recall that are not equipped with a tow hitch, Chrysler will install a Chrysler designed tow hitch free of charge, provided the condition of the vehicle can support proper installation. On vehicles in the recall that are equipped with an aftermarket tow hitch, Chrysler will assess whether the hitch and surrounding areas show evidence of sharp edges or other puncture risks. If so, Chrysler will replace the tow hitch with a Chrysler designed tow hitch free of charge, provided the condition of the vehicle can support proper installation. On vehicles already equipped with a Chrysler designed tow hitch, Chrysler will inspect the area around the tow hitch installation, and if any installation issues are identified, they will be repaired free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign numbers are N45 (for the Grand Cherokee vehicles) and N46 (for the Liberty vehicles).

13V-252

Elkhart Coach (Elkhart) is recalling certain model year 2006-2012 Elkhart coach model shuttle buses manufactured November 2006, through July 2012. The affected buses are equipped with a Ricon manufactured wheelchair lift which may have an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and, if it does not have a nonconductive cover, or it has an improperly installed nonconductive cover, a short circuit may occur that could result in a fire. Elkhart will notify owners and direct them to contact Ricon. Ricon will provide a supplemental cover kit with instructions, free of charge. The recall is expected to begin during July 2013. Owners may contact Elkhart at 1-574-264-5179 ext. 113 or Ricon at 1-818-267-3000.

13V-253

North American Bus Industries, Inc. (NABI) is recalling certain model year 2012-2013 40LFW and model year 2013 31LFW transit buses manufactured October 5, 2012, through May 15, 2013 and equipped with a rear mount Suttrak electric HVAC. The fuse holder inside the HVAC may allow voltage spikes, which may damage electrical components. Damage to electrical components may result in a fire. NABI will notify the fleet owner of the affected buses and dealers will replace the cables and fuse holders for the HVAC system, free of charge. The recall is expected to begin in early July 2013. NABI's recall number is 20135. Owners may contact NABI at 1-256-831-4296.

13V-254

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2011 Outlander Sport vehicles manufactured August 26, 2010, through March 29, 2011. The panoramic glass roof may have been installed without primer being applied before the adhesive. Without primer being used, the panoramic glass roof may have reduced adhesion, possibly allowing the glass roof to detach from the vehicle, resulting in a road hazard to other vehicles. MMNA will notify owners and dealers will inspect the panoramic glass to see if primer was installed. If primer is not present, the glass will be reinstalled. The recall is expected to begin on or about July 22, 2013. MMNA's recall number is SR-13-007. Customers may contact MMNA at 1-888-648-7820.

13V-255

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

Collins Bus Corporation (Collins) is recalling certain model year 2006-2007 Mid Bus CSD-7450R-C buses manufactured September 11, 2006, through October 25, 2007 and equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Collins will notify owners and instruct them to take their vehicle to their Mid Bus dealer where it will be inspected. If needed, Ricon will provide a supplemental cover kit and instructions free of charge. This recall campaign will begin in early July 2013. Owners may contact Collins at 1-800-533-1850 ext. 424, or Ricon at 1-800-322-2884.

13V-256

Zero Motorcycles Inc. (Zero) is recalling certain model year 2013 FX motorcycles manufactured January 28, 2013, through May 21, 2013; and model year 2013 XU motorcycles manufactured January 16, 2013, through May 20, 2013. A manufacturing defect with the sealant material in the battery may allow water to penetrate the battery and contact the cells. Water penetration into the battery may lead to corrosion of the cells, possibly resulting in a rapid temperature increase and off-gassing of the cells' electrolyte which may cause a burn to the rider. Zero will notify owners and dealers will replace the battery modules, free of charge. The recall began on June 26, 2013. Owners may contact Zero motorcycles at 1-888-786-9376.

13V-257

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2012-2013 R9X12T trailers manufactured May 25, 2012, through May 3, 2013. The air-brake booster valve was installed incorrectly, allowing the brake application time to exceed the permissible amount. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 121, "Air Brake Systems." The extra brake application time may result in extended stopping distances, increasing the risk of crash. Vermeer will notify owners, and dealers will re-plumb the air brake booster valve, free of charge. The recall is expected to begin by July 29, 2013. Owners may contact Vermeer at 1-641-628-3141. Vermeer's recall number is IK00-1843.

13V-258

Isuzu Manufacturing Services of America, Inc. (Isuzu) is recalling certain model year 2001-2013 Isuzu N-Series; model year 2001-2010 Chevrolet and GMC W-Series; model year 2001-2004 Isuzu FRR and model year 2001-2004 Chevrolet and GMC WT5500 trucks. The affected vehicles are equipped with an optional oil pan heater (RPO code IG3). Debris may collect at the contact point of the heater plug and the extension cord. This may cause overheating of the extension cord. Overheating of the extension cord could melt the oil pan heater plug and/or block heater plug, resulting in an increased risk of fire. Isuzu will notify owners and dealers will inspect the trucks. The extension cord and damaged components will be replaced, free of charge. The recall is expected to begin by August 2013. Owners may contact Isuzu at 1-866-441-9638.

13V-259

Honda is re-recalling certain model year 2007-2008 Fit vehicles covered under previous recall 10V-033. The remedy applied in this earlier recall may have been insufficient. In the affected vehicles, over time, the plastic cover may separate from the master power window switch allowing water to enter the driver's window and

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

reach the master power window switch. If the master power window switch is damaged as a result of the water intrusion, overheating and failure of the switch may result. An overheated switch can cause smoke, melting and fire. Honda will notify owners in July 2013 and will instruct owners to take their vehicles to dealers to have a free inspection conducted. If the switch is damaged, it will be replaced free of charge. If the switch is not damaged, the owner will be instructed to await a second notification that will instruct them to return to the dealer to have a replacement switch installed free of charge. Honda anticipates it will have sufficient parts inventory to notify owners of vehicles with undamaged switches to return to dealers for replacement switches in Fall 2013. Owners may contact Honda at 1-800-999-1009. Honda's recall number is JA6.

13V-260

Mobility Works is recalling certain model year 2006-2012 Ford E-150, E-250 and E-350 vehicles manufactured August 2006 through August 2012. The vehicles are equipped with certain Ricon S series and K Series wheelchair lifts with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and, if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, a short circuit may occur that could result in a fire. Mobility Works will notify owners and Ricon will provide a supplemental cover kit and instructions, free of charge. This recall campaign is expected to begin July 15, 2013. Owners may contact Mobility Works at 1-877-275-4912 and Ricon at 1-818-267-3000.

13V-261

Brammo, Inc. (Brammo) is recalling certain model year 2013 Empulse motorcycles manufactured November 19, 2012, through June 18, 2013. The rear tail assembly bracket can fatigue and may allow the rear tail assembly to break off while riding. If the rear tail assembly breaks off, it could contact the rear wheel, increasing the risk of a crash. The remedy for this recall campaign is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Brammo at 1-541-482-9555.

13V-262

Turtle Top is recalling certain model year 2009 Ford Odyssey vehicles manufactured August 1, 2006, through June 30, 2013 and equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Turtle Top will notify owners and Ricon will send owners a supplemental cover kit and instructions free of charge. This recall campaign will begin during July 2013. Owners may contact Turtle Top at 1-800-296-2105 or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

13V-263

Hyundai Motor Company (Hyundai) is recalling certain model year 2012-2013 Azera vehicles manufactured May 22, 2012, through November 23, 2012. The occupant detection system may fail to properly differentiate whether the front passenger seat occupant is an adult, a child or a child restraint seat. If the occupant is incorrectly classified, in the event of a crash necessitating airbag deployment, the airbag may deploy with greater or lesser force than appropriate, resulting in an increased risk of injury. Hyundai will notify owners, and dealers

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JUNE 2013

Published July 12, 2013

will recalibrate the airbag system. The manufacturer has not yet provided a notification schedule. Hyundai's recall number is "Campaign 111." Owners may contact Hyundai at 1-800-633-5151.

13V-264

Thor Motor Coach (Thor) is recalling certain model year 2006-2013 Windsport, model year 2006-2010 Magellan, model year 2007-2013 Hurricane, model year 2009-2013 Serrano and model year 2011-2013 A.C.E motorhomes. The motorhomes are equipped with an RV Custom Products Battery Control Center (BCC) which may experience a failure while the motorhome is in motion. If the BCC fails, all power may be lost to the motorhome chassis, including all lighting, making the vehicle very difficult to operate, increasing the risk of a crash. Thor will notify owners, and dealers will rewire the BCC free of charge. A notification schedule has not yet been provided. Customers may contact Thor at 1-877-855-2867. Thor's recall campaign number is RC000077.

13V-265

Spartan Motors Chassis, Inc. (Spartan Chassis) is recalling certain model year 2013 Metro Star and Gladiator emergency vehicles manufactured August 7, 2012, through June 6, 2013. Due to electrical signal fluctuations, the circuits in the restraints control module may become damaged. If damaged, the airbag or seat belt pretensioner may inadvertently deploy. If the seatbelt pretensioner or the air bag inadvertently deploys while driving, it may result in personal injury or increase the risk of a crash. Spartan Chassis will notify owners, and dealers will add a suppression device to reduce electrical signal fluctuations, free of charge. The recall is expected to begin by late to mid-July 2013. Owners may contact Spartan Chassis at 1-517-543-6400.

13V-266

EverGreen Recreational Vehicles, LLC (EverGreen) is recalling certain model year 2010-2012 Ever-Lite, and Element travel trailers. The trailers are equipped with propane cylinders that may leak gas or rupture. Leaking propane gas, in the presence of an ignition source, may result in a fire. EverGreen will notify owners and dealers will replace the propane cylinder, free of charge. The recall is expected to begin by July 19, 2013. Owners may contact Evergreen 1-574-825-4298.

13V-267

Volvo Trucks North America (Volvo) is recalling certain model year 2007-2014 VAH, VHD, VNL, VNM, and VT models. The affected vehicles were built without a redundant clutch disengagement switch. Without a redundant switch, a loss of signal from the brake air pressure switch can prevent the clutch from automatically disengaging when the brake is applied. Without a signal to disengage the clutch when the brakes are applied, the distance required to stop the truck may lengthen, increasing the risk of a crash. The remedy for this recall campaign is still under development. The recall is expected to begin by August 25, 2013. Volvo's recall number is RVXX1303. Owners may contact Volvo at 1-336-393-2000.

13V-268

Farber Specialty Vehicles (Farber) is recalling one 2011 Ford Chassis Mobile Classroom and one 2012 Ford 550 Bomb Response Unit vehicle equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Farber will notify owners and Ricon will send owners a supplemental cover kit and instructions free of charge. This recall campaign will begin by mid-July 2013. Owners may contact Farber at 1-800-331-3188 or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

13V-269

Ford Motor Company (Ford) is recalling certain model year 2013 Ford Explorer, Taurus, and Lincoln MKS vehicles manufactured November 29, 2012, through December 12, 2012. In the affected vehicles, with sufficient door openings and closings, the child safety locks may change from an activated position to a deactivated position without notice. If the child lock is deactivated, the door could be unlocked and opened from the inside which could lead to personal injury to an unrestrained child. Ford will notify owners, and dealers will test the safety locks. If necessary, the locks will be replaced free of charge. The recall is expected to begin August 5, 2013. Ford's recall number is 13S07. Owners may contact the Ford customer relationship center at 1-866-436-7332.

13V-270

General Motors (GM) is recalling certain model year 2012 Chevrolet Volt vehicles manufactured March 1, 2012, through April 17, 2012. Due to a brake pressure modulator valve problem, the vehicles do not relieve brake pressure from the front brakes during an anti-lock brake system (ABS), electronic stability control (ESC), or traction control event. One or both front brakes may lock up and not release. Thus, these vehicles fail to conform to Federal Motor Vehicle Safety Standards (FMVSS) No. 126, "Electronic Stability Control Systems" and No. 135, "Light Vehicle Brake Systems." If the brakes lock up it could cause a loss of steering control and/or a lengthened distance needed to stop the vehicle, increasing the risk of a crash. General Motors will notify owners, and dealers will install a new brake pressure modulator valve free of charge. The recall is expected to begin July 12, 2013. Owners may contact Chevrolet at 1-866-694-6546. GM's recall number is 13184.

13V-271

Logan Coach is recalling certain model year 2013 Razor 3-Horse Gooseneck trailers. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Logan Coach will notify owners and Dometic staff will replace the affected motors with motors of a different design. The recall is expected to begin in July 2013. Owners may contact Logan Coach at 1-800-742-7047 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-272

Nu Wa Industries Inc. (dba Kansas RV Center) is recalling one model year 2006 Hitchhiker Champagne Edition recreational vehicle. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JUNE 2013

Published July 12, 2013

crash. Nu Wa Industries Inc. will notify the one owner and Dometic staff will replace the affected motor with a motor of a different design, free of charge. The notification was mailed to the owner on July 8, 2013. Owners may contact Nu Wa at 1-620-431-2088 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-273

Eldorado National-Kansas (ENK) is recalling certain model year 2011-2013 Amerivan Toyota Sienna vans manufactured February 17, 2011, through June 25, 2013. The fuel filler neck may contact the left rear shock absorber. This could damage the fuel filler neck. If the shock makes contact with the fuel filler neck, it could damage the neck allowing it to leak gasoline vapors and result in a fire or explosion causing personal injury. ENK will notify owners, and dealers will relocate the shock absorbers and add a spacer, free of charge. The recall began on July 12, 2013. Owners may contact Eldorado National-Kansas at 1-800-955-9086.

13V-274

Altec Industries, Inc. (Altec) is recalling certain model year 2002-2010 AH75, AH85 and AH100 aerial devices equipped with square pedestals. In the affected vehicles, the aerial device may develop cracks between the pedestal and the unit subbase. Cracks in the pedestal may cause the aerial device to fail, increasing the risk of personal injury. Altec will notify owners informing them to inspect the pedestal and if any cracks are found, they will be repaired free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Altec at 1-800-860-0183. Altec's recall number is CSN 580.

13V-275

Altec LLC (Altec) is recalling certain model year 2008-2009 ALTEC LLC/LIFT-ALL LSS aerial devices manufactured December 2008 through October 2009. Cracks may develop in the turntable. Cracks may result in failure of the aerial device, increasing the risk of personal injury to the worker or those nearby. Altec will notify owners to inspect the turntable. A stiffener repair kit will be installed on the turntable, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Altec at 1-800-860-0183. Altec's recall number is CSN 582.

13V-276

Starcraft is recalling certain model year 2014 Launch Ultra Light travel trailers manufactured April 1, 2013, through April 10, 2013. An incorrect cargo carrying capacity is printed on the RV Trailer Cargo Carrying Capacity Label and the Tire and Loading Information Placard. Thus, the trailers fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 110, "Tire Selection and Rims for Passenger Cars." The vehicle could be loaded with the incorrect amount of cargo resulting in overloading of the tires which may lead to tire failure, increasing the risk of a crash. Starcraft will notify owners, and dealers will replace the labels. The recall is expected to begin in late July 2013. Owners may contact Starcraft at 1-800-945-4787.

13V-277

Prevost is recalling certain model year 2013 X3-45 Le Mirage Entertainer XL2 coach shells and certain model year 2014 X3-45 highway coaches manufactured October 9, 2012, through June 6, 2013. Improper voltage is being supplied to the tail lamps causing the brightness of the tail lamps to exceed the requirements of Federal

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2013

Published July 12, 2013

Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." Drivers may mistake exceedingly bright tail lamps to be brake lamps confusing following drivers about the intention to brake, increasing the risk of a crash. Prevost will notify owners and dealers will update the lamp controller software to ensure the correct voltage is reaching the affected lamps, free of charge. The manufacturer has not yet provided a notification schedule. Prevost's recall number is SR13-53. Owners may contact Prevost at 1-336-393-2233.

13V-278

BMW of North America (BMW) is recalling certain model year 2013 F700 GS and F800 GS motorcycles manufactured June 1, 2012, through October 18, 2012. The side-stand switch that prevents the engine from running while the side-stand is down may become damaged allowing the engine to run with the side-stand down. The rider may start riding with the side-stand down, increasing the risk of a crash. BMW will notify owners and dealers will secure the side-stand switch, free of charge. The recall is expected to begin in August 2013. Owners may call BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

13V-279

LDV, Inc. is recalling certain 2012-2013 mobile specialty vehicles. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. LDV, Inc. will notify owners and Dometic staff will replace the affected motors with motors of a different design. The recall is expected to begin in mid-July 2013. Owners may contact Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-280

La Boit Specialty Vehicles Inc. (La Boit) is recalling certain model year 2013 Mobile Services vehicles. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. La Boit will notify owners and Dometic staff will replace the affected motors with motors of a different design. A notification schedule has not yet been provided. Owners may contact La Boit at 1-800-776-9984 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-281